Camp Springs Field Service, LLC 500 Ernie's Place Falmouth, KY 41040

Invoice

 Date	Invoice #	
5/6/2022	4352	-

Bill To	
Brass Eagle Excavation 3248 Rainbow Terrrace Erlanger, KY 41018-2229	
	1

Terms	Machine	Hours
Net 15		

Serviced	Quantity	Description	Item	Rate	Amount
4/16/2022 4/16/2022 4/16/2022	50 25 2.5	D5C III Site Travel Mileage Fee Diesel Fuel Surcharge Regular hourly work-Work on frozen blade pin - couldn't move.	Mileage Fuel Hourly	2.00 1.00 100.00	100.00 25.00 250.00
5/2/2022 5/2/2022 5/2/2022	25	Doosan 140 Site Travel Mileage Fee Diesel Fuel Surcharge Regular hourly work-Diagnose machine for not starting; found starter failed - remove starter.	Mileage Fuel Hourly	2.00 1.00 100.00	100.00 25.00 250.00
5/6/2022	u .	Discounted Rate KY Sales Tax	Discount	-375.00 6.00%	-375.00 0.00
				,	
4)

Thank you for your business.

Total

\$375.00

Phone #	E-mail
859.393.4376	jbezold@zoomtown.com

	7
5	
C)
	-
C	•

Bill To

Brass Eagle Excavation
3248 Rainbow Terrace
Erlanger, KY 41018-2229

\$3,300.00	€9	Total	To	A monthly Finance Charge of 2% (24%APR) will be added on all past due amounts.	Charge of 2% (24%APR	A monthly Finance
						,
0.00		6.00%	Hourly	Regular hourly work-R&R broken bolts; Repair track guard mounts. KY Sales Tax	3 Reg gua KY	6/21/2022
1,800.00 500.00 300.00 400.00		100.00 100.00 100.00	Hourly Hourly Hourly Hourly	Regular hourly work-R&R tracks with pad change Regular hourly work-Reseal track adjusters Regular hourly work-R&R segments Regular hourly work-R&R (2) blade pins & polish; Weld keepers	18 Reg 5 Reg 3 Reg 4 Reg	6/21/2022 6/21/2022 6/21/2022 6/21/2022
Amount	Ame	Rate	Item	Description	Quantity	Serviced
				D5C Serial # 8ZS433	Net 15	
		Hours		Machine	Terms	

Phone # 859.393.4376

E-mail
jbezold@zoomtown.com



Date	Invoice #
7/10/2024	4555

Bill To

Brass Eagle Excavation 3248 Rainbow Terrrace Erlanger, KY 41018-2229

Terms	Machine	Hours
Net 15	D5C Serial # 8ZS433	

Serviced	Quantity	Description	Item	Rate	Amount
6/13/2024	1	Radiator	Radiator	2,700.00	2,700.00T
6/13/2024	1	Cap - Radiator	Cap	19.99	19.99T
6/13/2024	3	O-Ring	2H9247	3.13	9.39T
6/13/2024	4	Ring	2K2961	5.34	21.36T
6/13/2024	2	Seal	8J1688	1.95	3.90T
6/13/2024	3	Ring	8J1689	2.95	8.85T
6/13/2024		Miscellaneous Parts-Arm rests for 953	Misc. Parts	75.00	150.00T
0,10,202		KY Sales Tax		6.00%	174.81
					1.0
	Table -				

A monthly Finance Charge of 2% (24%APR) will be added on all past due amounts.

Total

\$3,088.30

Phone #	E-mail
859.393.4376	jbezold@zoomtown.com



Date	Invoice #	
7/11/2024	4556	

Bill To			
Brass Eagle Excavation	-	un gesettet er fan genaat in het en wek som	
3248 Rainbow Terrrace			
Erlanger, KY 41018-2229			

Terms	Machine	Hours
Net 15	D5C Serial # 8ZS433	

Serviced	Quantity	Description	Item	Rate	Amount
6/12/2024	6	Regular hourly work-Clean up engine; R&R valve cover gasket KY Sales Tax	Hourly	120.00 6.00%	720.00

A monthly Finance Charge of 2% (24%APR) will be added on all past due amounts.

Total

\$720.00

Phone #	E-mail
859.393.4376	jbezold@zoomtown.com



Date	Invoice #
7/11/2024	4557

Bill To	
Brass Eagle Excavation	
3248 Rainbow Terrrace	
Erlanger, KY 41018-2229	

Terms	Machine	Hours
Net 15	953 Serial # 20Z1553	

Serviced	Quantity	Description	Item	Rate	Amount
10/7/2024	2	Regular hourly work-Welding repairs to exhaust KY Sales Tax	Hourly	120.00 6.00%	240.00 0.00
		K1 Sales Tax			

A monthly Finance Charge of 2% (24%APR) will be added on all past due amounts.

Total

\$240.00

Phone #	E-mail
859.393.4376	jbezold@zoomtown.com

Price	Exte	ended Price		
\$ 120.00	\$	180.00	\$6,000.00	Owed for roller
\$ 120.00	\$	300.00		
\$ 120.00	\$	360.00		
\$ 120.00	\$	960.00		
\$ 120.00	\$	180.00		
\$ 120.00	\$	1,140.00		
\$ 120.00	\$	960.00		
\$ 120.00	\$	960.00		
\$ 120.00	\$	960.00		
umakati katan 1981 ya matan ki katan k	\$	6,000.00		
			•	Balance owed for roller
	\$ 120.00 \$ 120.00 \$ 120.00 \$ 120.00 \$ 120.00 \$ 120.00 \$ 120.00 \$ 120.00	\$ 120.00 \$ \$ 120.00 \$ \$ 120.00 \$ \$ 120.00 \$ \$ 120.00 \$ \$ 120.00 \$ \$ 120.00 \$ \$ 120.00 \$ \$ 120.00 \$ \$ 120.00 \$	\$ 120.00 \$ 180.00 \$ 120.00 \$ 300.00 \$ 120.00 \$ 360.00 \$ 120.00 \$ 960.00 \$ 120.00 \$ 1,140.00 \$ 120.00 \$ 960.00 \$ 120.00 \$ 960.00 \$ 120.00 \$ 960.00	\$ 120.00 \$ 180.00 \$6,000.00 \$120.00 \$ 300.00 \$ \$ 120.00 \$ 360.00 \$ \$ 120.00 \$ 960.00 \$ \$ 120.00 \$ 1,140.00 \$ \$ 120.00 \$ 960.00 \$ \$

Date	Machine	Description	# Units
8/30/2023		R&R Bearings on idler pulley	1.5
9/21/2023	953	Clean out rediator; Check oil leak on tilt cylinder; Create parts list	2.5
9/21/2023		Clean out radiator; Adjust fan bet:Check exhaust leak; Create parts list	3.0
10/11/2023		Repair wiring to engine temp. gauage; Test cooling System; Needs radiator cap.	8.0
3/15/2024		Pressure test cooling system-Radiator leaking	1.5
3/16/2024		R&R (6) glow plugs;Repair coolant leak at top of head	9.5
4/8/2024		Remove Radiator	8.0
6/12/2024		Clean up machine & parts; Set radiator & begin install	8.0
6/17/2024		Install radiator; fill with coolant; test for leaks; Install panels & hood	8.0
		Total Charges	

	\$6,0															
Extended Price	180.00	300.00	360.00	9.39	21.36	3.90	8.85	240.00		960.00	38.49	13.58	39.20	180.00	1,140.00	75.00
Exte	\$	\$	\$	\$	\$	\$	\$	\$		❖	\$	\$	\$	\$	\$	\$
Price	1.5 Hourly \$120.00	\$120.00	\$120.00	\$ 3.13	\$ 5.34	\$ 1.95	\$ 2.95	\$120.00		\$120.00	\$ 12.83	\$ 13.58	\$ 19.60	1.5 Hourly \$120.00	9.5 Hourly \$120.00 \$	\$ 37.50
Units	Hourly			3.0 Each	4.0 Each	2.0 Each	3.0 Each	2.0 Each		8.0 each	3.0 Gal.	1.0 Gal.	2.0 Gal.	Hourly	Hourly	2.0 Each
# Units Units	1.5	2.5	3.0	3.0	4.0	2.0	3.0	2.0		8.0	3.0	1.0	2.0	1.5	9.5	2.0
Description	953 R&R Bearings on idler pulley	953 Clean out rediator; Check oil leak on tilt cylinder; Create parts list	9/21/2023 DSC III Clean out radiator; Adjust fan bet:Check exhaust leak; Create parts list	953 2H9247 - Seal;O-Ring	953 2K2961	953 811688	953 811689	Welding Repairs to Exhaust	Repair wiring to engine temp. gauage; Test cooling System; Needs	radiator cap.	Transmission oil	Anti Freeze	0il 80W90	Pressure test cooling system-Radiator leaking	R&R (6) glow plugs; Repqir collant leak at top of head	953 2 arm rests re-upholtser
Machine		953	DSC III	953	953	953	953				D5C III	DSC III				
Date	8/30/2023	9/21/2023	9/21/2023	10/2/2023	10/2/2023	10/2/2023	10/2/2023	10/7/2023 D5C III		10/11/2023 D5C III	10/11/2023 D5C III	10/11/2023 D5C III Anti Freeze	10/11/2023 D5C III	3/15/2024 D5C III	3/16/2024 D5C III	3/16/2024

\$2,505.23 Balance owed for roller

3,494.77 Total Charges



Date	Invoice #
7/10/2024	4555

Bill To

Brass Eagle Excavation 3248 Rainbow Terrrace Erlanger, KY 41018-2229

Terms	Machine	Hours
Net 15	D5C Serial # 8ZS433	

Serviced	Quantity	Description	Item	Rate	Amount
6/13/2024 6/13/2024 6/13/2024 6/13/2024 6/13/2024 6/13/2024 6/13/2024	2	Seal Ring	Radiator Cap 2H9247 2K2961 8J1688 8J1689 Misc. Parts	2,700.00 19.99 3.13 5.34 1.95 2.95 75.00 6.00%	19.99T 9.39T 21.36T 3.90T 8.85T

A monthly Finance Charge of 2% (24%APR) will be added on all past due amounts.

Total

\$3,088.30

Phone #	E-mail
859.393.4376	jbezold@zoomtown.com



Date	Invoice #
7/11/2024	4556

Bill To

Brass Eagle Excavation 3248 Rainbow Terrrace Erlanger, KY 41018-2229

Terms	Machine	Hours
Net 15	D5C Serial # 8ZS433	

Serviced	Quantity	Description	Item	Rate	Amount
6/12/2024		Regular hourly work-Clean up engine; R&R valve cover gasket KY Sales Tax	Hourly	120.00	720.00

A monthly Finance Charge of 2% (24%APR) will be added on all past due amounts.

Total

\$720.00

Phone #	E-mail
859.393.4376	jbezold@zoomtown.com



Date	Invoice #	
7/15/2024	4558	

Bill To

Brass Eagle Excavation
3248 Rainbow Terrrace
Erlanger, KY 41018-2229

Terms	Machine	Hours
Net 15	D5C Serial # 8ZS433	

Serviced	Quantity	Description	Item	Rate	Amount
7/15/2024 7/15/2024 7/15/2024	1 1 1	Filter Top Gasket Kit Freight charges KY Sales Tax	1R0734 1073731 Freight	14.45 252.35 29.24 6.00%	14.45T 252.35T 29.24T 17.76
2					

A monthly Finance Charge of 2% (24%APR) will be added on all past due amounts.

Total

\$313.80

Phone #	E-mail
859.393.4376	jbezold@zoomtown.com



Date	Invoice #
7/15/2024	4 4558

Bill To	
Brass Eagle Excavation	
3248 Rainbow Terrrace	
Erlanger, KY 41018-2229	

Terms	Machine	Hours
Net 15	D5C Serial # 8ZS433	

Serviced	Quantity	Description	Item	Rate	Amount
7/15/2024 7/15/2024 7/15/2024	1 1 1	Filter Top Gasket Kit Freight charges KY Sales Tax	1R0734 1073731 Freight	14.45 252.35 29.24 6.00%	252.35T

A monthly Finance Charge of 2% (24%APR) will be added on all past due amounts.

Total

\$313.80

Phone #	E-mail
859.393.4376	jbezold@zoomtown.com





5252 Walcutt Court P.O. Box 28525 Columbus, Ohio 43228 (614) 878-2287 Fax: (614) 851-5015



HOLT COMPANY OF OHIO S•O•S WEAR ANALYSIS

BRASS EAGLE, INC

7601 HIGHWAY 42 FLORENCE, KY 41042 SHOP JOB NUMBER:

SEGMENT NUMBER:

CUSTOMER EQUIPMENT NUMBER:

JOB SITE:

STOW COL SHOP Caterpillar

M12882

MANUFACTURER:

D5C

MODEL: SERIAL NUMBER:

08ZS00433

Yes

Engine

COMPARTMENT NAME:

SAMPLE OIL BRAND/WEIGHT:

OIL CHANGED AT SAMPLE TIME: CUSTOMER P.O. NUMBER:

SAMPLE LABEL NUMBER:

MARKET STATUS:

LAB CONTROL NUMBER:

OVERALL EVALUATION:

02801698

Normal

PROCESSED DATE

02/01/02

SAMPLE

DATE

EQUIPMENT MILES/HRS

MILES/HRS

ON OIL

SINCE CHANGE

ADDED

All wear metals are acceptable. Compartment wear appears to be normal. Copper may be from gasket sealants.

High copper may be due to oil additives. Continue sampling at the normal sample interval.

01/25/02 1040

1040

04/27/99

Normal wear on a first sample basis. Normal break-in wear.

Silicon may be from gasket sealants.

More samples needed to establish a wear trend. Continue sampling at the normal sample interval.

04/22/99 3

3

PREVIOUS #2

PREVIOUS #3

WEAR ELEMENTS:

OIL CONDITION/CONTAMINANTS

SUL NIT VIS TBN OXI CR PB AL SI NA MO SN CA ZN MG В W Α ST CU FE

9 8 10 3 2882 1330 340 1090 N 98 25 59 48 3 6 44 44 6

27 963 19 12 0 20 5 5 11 4 1

* AL = ALUMINUM CR = CHROME CU = COPPER

FE = IRON

PB = LEAD NA = SODIUM MO = MOLYBDENUM SI = SILICON

ST = SOOT SUL = SULPHUR PRODUCTS OXI = OXIDATION

NIT = NITRATION

SN = TIN CA = CALCIUM ZN = ZINCMG = MAGNESIUM

P = PHOSPHOROUS

F = FUEL A = ANTIFREEZE W = WATER VIS = VISCOSITY





To:

Brass Eagle

7601 Hwy 42

Florence, KY 41042

Customer Number: BE02	Date of Order: 10/01/2002
Phone: 8595125022	

Customer Order Number:

Truck/Unit	Make	Model	Year/Ser#	Mileage/Hours
	CAT	D5C	87S00433	1,260
Engine	Transmission	Differential	TERMS: Net 30 Days. Finance Charge of 11/2 (18% Annual) on all accounts over 30 days.	

QTY	PART	PRICE	AMT	Work Performed:
				Service Call To Blue Ash. Checked No Start Condition. Removed Sheet Metal As Needed. Tightened Loose Ground Cable At Battery. Found Machine Loosing Voltage To Signal Relay When In Crank Position. Trace Wiring Problem And Repaired Wiring Under Right Side Of Floor Board. Reinstalled Sheet Metal. Also Welded A Bracket On JCB 215S Fork.
				Hours Rate Total Parts: \$0.00

Hours	Rate	Total Parts:	\$0.00	
4.00	\$ 65.75	Total Labor:	263.00	
	Shop Supplies/Chemical			
		factory completion of the above Tax:	\$15.94	
described work	IGNATURE: I hereby acknowledge the satisfactory completion of the above Tax: escribed work Thank You!Pay This Amount			



To:

Brass Eagle

7601 Hwy 42 Florence, KY 41042

Date of Order: Customer Number: 09/20/2002 BE02

Phone:

8595125022

Customer Order Number:

Truck/Unit	Make JCB	Model 215S	Year/Ser# 215SOC E406910	Mileage/Hours 3,710
Engine	Transmission	Differential	TERMS: Net 30 Days. F (18% Annual) on all acco	inance Charge of 11/2% per month ounts over 30 days.

QTY	PART	PRICE	AMT	Work	Performe	d:		
1.00	46-92800 PLUG	\$ 7.09	\$ 7.09	See Encl	osed Sheet	•		
								and the second of the second
	2 1							
				Hours	Rate		Total Parts:	\$7.09

Hours	Rate	Total Part	s: \$7.09			
14.00	14.00 \$ 65.75 Total Labor:					
	9.28					
SIGNATURE: I	hereby acknowledge th	tisfactory completion of the above $T_{\mathcal{E}}$	x: \$56.21			
described work		Thank You!Pay Tl Amou				

Four service calls to Blue Ash, to check out four wheel steering, four wheel drive, and no start.

First service call:

Checked no start, Found negative battery cable not making a good connection at the battery. Removed the cable from machine and cleaned both ends, installed a new bolt in cable end, installed cable. Machine started fine, check charging system, charging was o.k. Look at four wheel steer and four wheel drive. Four wheel steer system needed a switch in dash to start with (switch was missing). Check out four wheel drive system, everything in cab seemed to work fine, check for power and ground at solenoid, o.k. Ohm check solenoid magnet seemed alright but valve on solenoid could have been stuck. Needs a new solenoid.

Second service call:

Machine would not start again. Check negative battery cable, it was o.k. Check to insure machine was charging still, machine not charging. Found plug on back of the alternator bad, took plug apart and patched together to make sure alternator was still good, alternator was fine but plug needed to be replaced in order to prevent future problems. Install four wheel steer switch, machine still will not steer. Check proximity switches located on front and rear axles. Rear switch was out of adjustment and front was damaged, remove switch from front axle. Try to replace four wheel drive solenoid but it was wrong.

Third service call:

Install new plug for alternator, and make sure machine was charging. Installed new front proximity switch and adjust. Machine still would not steer. Took dash apart to trace wires out. Found four wheel steer switch not getting power from front proximity switch. Found wire shorted to ground, ran a new wire from four wheel steer switch to front proximity switch. Checked steering, steered fine. Tried to put four wheel drive solenoid on, but it was wrong again.

Fourth service call:

Got the wrong four wheel drive solenoid again. Took the new solenoid and the old solenoid and made one good solenoid. Installed the solenoid into the transmission and tried, four wheel drive still did not work properly. Transmission must have an internal problem preventing it from working properly. Removed front grill from machine to check out a hydraulic leak, found oil cooler cracked and leaking.

Note: Customer supplied and returned all parts from JCB.

CAMP Springs Field Service, LLC 6510 Lower tug Fork Road Camp Springs Alexandria, KY 41001-9524 (859) 393-4376



Invoice

INVOICE#
1649

BILL TO

Brass Eagle Excavation 7601 Highway 42 Florence, KY 41042

P.O. NUMBER		TERMS	MACHINE HRS.		EQUIPME	ENT				
Verbal 2% 10 Net 30 2403					D5C Serial # 8ZS433					
SERVICED	QTY.		DESCRIPTION		RATE	ITEM	AMOUNT			
5/30/2005 5/30/2005			work-Repair thread	ls on air filter	1.00 60.00 6.00%	Mileage Hourly	25.00 90.00 0.00			
					C CONC		AT.			
iank you fo	DR YO	ur business.			TOTAL		\$115.00			

CAMP Springs Field Service, LLC 6510 Lower tug Fork Road Camp Springs Alexandria, KY 41001-9524 (859) 393-4376



Invoice

DATE	INVOICE#
7/26/2006	1901

BILL TO

Brass Eagle Excavation 7601 Highway 42 Florence, KY 41042

P.O. NUMBER		TERMS	MACHINE HRS.		EQUIPMENT					
Verbal 2% 10 Net 30 2820					D5C Serial # 8ZS433					
SERVICED	QTY.		DESCRIPTION		RATE	ITEM	AMOUNT			
7/20/2006 7/20/2006	25 2.5	Regular hourly and little fuel o tank-little fuel;	work-Clean fuel ut of hose; Remo Clean out fuel lir -ok; Free up hydr	ne-good fuel to	1.25 Mileage 65.00 Hourly		31.25 162.50 0.00			
HANK YOU F	OR YO	our business.			ТОТА	L	\$193.75			



3993 E. ROYALTON RD. BROADVIEW HTS., OH 44147

Inquires Call: 440.526.6200 / 800.837.6200

INVOICE - Parts/Service

ADDRESS SERVICE REQUESTED

SOLD TO:

000202 * 000005 006 000853

BRASS EAGLE INC 7601 US HIGHWAY 42 FLORENCE, KY 41042-5530 SHIP TO:

INVOICE NUI	WBER	INVOICE DATE	CUSTOMER NO.		CUSTOME	PURCHASE ORDER NUMBER	STORE	PSO/WO NO.		PAGE	
WO100110	0455	06-09-09	21040	030			10	RI048	300	1	
MAKE	1	MODEL	SERI	SERIAL NUMB		IBER EQUIPMENT NUMBER		READING	DOC. D	DOC. DATE	
AA D5C III XL		08Z	08ZS00433		M12882		39.0	05-27	27-09		
QUANTITY		ITEM	*NR	15.	DESCRIPTION		UNIT PR	ICE	EXTENSION	100	

TROUBLESHOOT FUEL SYSTEM

CUSTOMER COMPLAINT:

THE MACHINE WOULD QUIT RUNNING AFTER OPERATING FOR APPROXIMATELY A HALF HOUR. IT WAS ACTING AS IF IT WERE NOT GETTING FUEL.

CAUSE OF FAILURE:

BAD FUEL DELIVERY HOSE.

RESULTANT DAMAGE:

THE TRANSFER PUMP CAVITATED CAUSING THE PISTON TO GET SCORED, WHICH CREATED LOW FUEL PRESSURE.

REPAIR PROCESS COMMENTS:

CHECKED THE FUEL SYSTEM. DISASSEMBLED THE TRANSFER PUMP AND FOUND THE PISTON WAS WORN AND REPLACED THE TRANSFER PUMP AND RAN THE SCORED. THE MACHINE RAN APPROXIMATELY 15 MACHINE. MINUTES WHEN IT WOULD BEGIN TO STARVE FOR FUEL AND THEN QUIT. THE MACHINE WAS BROUGHT TO THE SHOP WHERE A FITTING WAS MADE TO CHECK THE FUEL INSTALLED THE FITTING AND GAUGE THEN PRESSURE. RAN THE MACHINE. DID NOT GET PRESSURE AT HIGH REMOVED THE SUCTION LINE AND HOOKED THE VACCUM PUMP TO THE LINE. PULLED A VACCUM ON THE LINE TO PULL FUEL IN. IT TOOK 15 LBS OF VACCUM REMOVED THE LINE AND BLEW TO PULL THE FUEL. THE AIR WAS RESTRICTED. THE AIR IN. BLEW ATR INTO THE OTHER END AND FOUND THAT IT WAS NOT ORDERED A NEW LINE AND INSTALLED. RESTRICTED.

* - NOT RETURNABLE

PAYMENT TERMS: Net 30 Days from invoice date.
A monthly Finance Charge uo to 2% (24%APR) will be added on all past due amounts. Title to goods remains with seller until full payment is received. Returned parts must be accompanied by invoice or Packing list and are subject to a restocking fee. Parts designed with an asterick (*) are not returnable.

PLEASE REMIT TO:

Ohio CAT BOX 931029 CLEVELAND, OH 44193

PAY THIS: AMOUNT	CONT'D
CREDIT	elinosta Tubi Derri Nacioni
AMOUNT	Lini decimi



3993 E. ROYALTON RD. **BROADVIEW HTS., OH 44147**

Inquires Call: 440.526.6200 / 800.837.6200

INVOICE - Parts/Service

ADDRESS SERVICE REQUESTED

SOLD TO:

SHIP TO:

000853

BRASS EAGLE INC 7601 US HIGHWAY 42 FLORENCE, KY 4 41042-5530

UMBER INVOICE DATE C		INVOICE DATE CUSTOMER NO. CUSTOMER PURC		STOMER PURCHASE ORDER NUMBER	STORE	PSO/WO NO.		PAGE
0455	06-09-09	2104	1030		10	RI048	800	2
AKE MODEL SERIAL NUMI		EQUIPMENT NUMBER	METER READING		DOC. DATE			
		08ZS00433 M12882		M12882	338	39.0	05-27-09	
	ITEM	*NR		DESCRIPTION	UNIT PR	ICE	EXTENSIO	N
AND CH	ECKED THE	FUEL	PRESS	. THE PRESSURE				
	0455 D50	0455 06-09-09 MODEL D5C III XL ITEM	0455 06-09-09 2104 MODEL SE D5C III XL 08 ITEM 'NR	0455 06-09-09 2104030 MODEL	0455 06-09-09 2104030 MODEL	10 10 10 10 10 10 10 10	0455 06-09-09 2104030 10 R1048 R10	0455 06-09-09 2104030 10 R104800

WAS NORMAL. OPERATED THE MACHINE AND THE PRESSURE STAYED WERE IT SHOULD AND DID NOT STALL THE MACHINE. REINSTALLED PANELS THAT HAD TO BE REMOVED TO MAKE THE REPAIR. REPAIR COMPLETE.

DE	LARIAC A TAD	 	 							
1	51-7951		FUEL FII	TER	s			13.95	13.95	
2	5P-4961		CLAMP		S			2.94	5.88	
1	108-4831		HOSE A		5%EPN			19.72	19.72	
1	118-6814		PUMP G-1	TRF	5%EPN			238.42	238.42	
			TOTAL	PART	s	SEG.	01		277.97	*
			RT SI	OP LA	BOR				712.00	
			TOTAL	L LABO	R	SEG.	01		712.00	*
1.	00		EXSR	v: 118	6814				11.92	
	00		EXSR	v: 108	4831				.99	
Τ.	00									
			TOTA	L MISC	CHGS	SEG.	01		12.91	*
			इस् स	MENT O	1 TOTAL				1002.88	T

SUPPLIES/ENV CHG

19.58 T

* - NOT RETURNABLE


PAYMENT TERMS: Net 30 Days from invoice date.
A monthly Finance Charge uo to 2% (24%APR) will be added on all past due amounts. Title to goods remains with seller until full payment is received. Returned parts must be accompanied by invoice or Packing list and are subject to a restocking fee. Parts designed with an asterick (*) are not returnable.

PLEASE REMIT TO:

Ohio CAT BOX 931029 CLEVELAND, OH 44193

PAY THIS: AMOUNT	CONT'D
CREDIT AMOUNT	

Camp Springs Field Service, LLC 6510 Lower Tug Fork Road Alexandria, KY 41001 859-393-4376

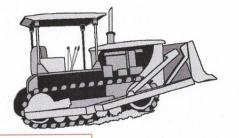

Invoice

DATE	INVOICE#
1/4/2011	2704

BILL TO


Brass Eagle Excavation 7601 Highway 42 Florence, KY 41042

PO NUMBE	R	TERMS	MACHINE HRS		EQU	IPMENT	
Verbal		Net 15		D5C Serial # 8ZS433			
SERVICED	QTY	DESCRIPTION Regular hourly work-Drain coolant; Remove injection pump & oil cooler.			RATE	ITEM	AMOUNT
1/29/2010	5			Remove	65.00	Hourly	325.00
2/2/2010	1		work-Clean up parts		65.00	Hourly	65.00
2/31/2010	4	Regular hourly	work-Finish cleaning vil cooler and injection	parts;		Hourly	260.00
/3/2011	1.5		work-Add (2) gallons		65.00	Hourly	97.50
/3/2011	1	Battery			92.45	Battery	92.451
/3/2011		Anti-freeze			12.66	Anti-freeze	25.327
		KY Sales Tax			6.00%		7.07

Phone # Fax # 859.393.4376 859.635.0098

E-mail
jbezold@zoomtown.com

Camp Springs Field Service, LLC 6510 Lower Tug Fork Road Camp Springs Alexandria, KY 41001-8834

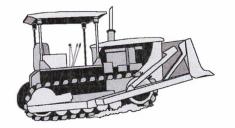

Invoice

Date	Invoice #
12/2/2013	3186

Bill To		
Brass Eagle Excavation 7601 Highway 42 Florence, KY 41042		

P.O. No.	Terms	Machine
Verbal	Net 15	D5C Serial # 8ZS433

Serviced	Quantity	Description	Item	Rate	Amount
11/22/2013 11/22/2013	70 1.5	Site Travel Mileage Fee Regular hourly work-Check for engine not running; Found fuel line clogged at tank; Blow out line with air; Bleed fuel system & test run-OK; Tank needs cleaned.	Mileage Hourly	2.00 75.00	140.00 112.50
		KY Sales Tax		6.00%	0.00
			,		
	-				
		clears.		$(a_{j_0}e$	
		The case of the second of the control of the case of the case of the second of the case of	photos	2742	

A monthly Finance Charge of 2% (24%APR) will be added on all past due amounts. Credit cards accepted.

Total

\$252.50

Phone #	Fax#	E-mail
859.393.4376	859.635.0098	jbezold@zoomtown.com

Invoice

Camp Springs Field Service, LLC 6510 Lower Tug Fork Road Camp Springs Alexandria, KY 41001-8834

Date	Invoice #
10/28/2014	3309

Bill To	
Brass Eagle Excavation 3248 Rainbow Terrrace Erlanger, KY 41018-2229	

P.O. No.	Terms	Machine
Verbal	Net 15	D5C Serial # 8ZS433

Serviced	Quantity	Description	Item	Rate	Amount
10/27/2014 10/27/2014	56 4	Site Travel Mileage Fee Regular hourly work-R&R broken grease fitting blade mount; Clean out and grease it; Free up b	Mileage g on Hourly rake	2.00 75.00	112.00 300.00
		peddles and adjust brakes. KY Sales Tax		6.00%	0.00

A monthly Finance Charge of 2% (24%APR) will be added on all past due amounts. Credit cards accepted.

Total

\$412.00

Phone #	Fax#	E-mail
859.393.4376	859.635.0098	jbezold@zoomtown.com



Service Invoice

Invoice:

WO100123532

Ref Doc:

RI11121

P.O. Number:

Invoice Amount:

\$1001.38

Invoice Date:

02/12/16

Sold To: 2104030

BRASS EAGLE INC

SEGMENT 01: TROUBLESHOOT CHARGING SYSTEM

CHARGING LIGHT ON, MACHINE REQUIRES JUMP STARTING.

CUSTOMER COMPLAINT:

CHARGING LIGHT ON, MACHINE REQUIRES JUMP STARTING

CAUSE OF FAILURE:

ALTERNATOR NOT CHARGING

RESULTANT DAMAGE:

FAILED ALTERNATOR

REPAIR PROCESS COMMENTS:

INSTALLED NEW ALTERNATOR ANOTHER TECH HAD ORDERED.

INSTALLED NEW ALTERNATOR AND ADJUSTED BELTS AS

NEEDED. BOTH BELTS ARE WORN AND DRY ROTTED,

RECOMMEND NEW BELTS SOON. TESTED OPERATION OF

ALTERNATOR, ALL CHECKS GOOD, NO FURTHER PROBLEMS

AT THIS TIME.

PARTS:	DESCRIPTION	STK/NON-STK	UNIT PRICE	EXTENSION
20		G N	248.46	248.46
1 1			258.60	258.60
1-			258.60	258.60-
	TOTAL PA	ARTS SEG	. 01	248.46
	RT SHOP	LABOR		226.00
	TOTAL LA	ABOR SEG	. 01	226.00
	SEGMEN	r 01 TOTAL		474.46
	QUANTITY PART NO 1 0R-4327 1	QUANTITY PART NO DESCRIPTION 1 OR-4327 ALTERNATOR CORE DEPOSITION CORE RETURN TOTAL PART SHOP	QUANTITY PART NO DESCRIPTION STK/NON-STK 1 0R-4327 ALTERNATOR G N 1 CORE DEPOSIT N 1- CORE RETURN N TOTAL PARTS SEG RT SHOP LABOR TOTAL LABOR SEG	QUANTITY PART NO DESCRIPTION STK/NON-STK UNIT PRICE 1 OR-4327 ALTERNATOR G N 248.46 1 CORE DEPOSIT N 258.60 1- CORE RETURN N 258.60 TOTAL PARTS SEG. 01 RT SHOP LABOR TOTAL LABOR SEG. 01

SEGMENT 02: TROUBLESHOOT BRAKE PEDAL

BRAKE PEDALS STICKING, FREE UP PEDALS AND

ADJUST BRAKES AS NEEDED.

CUSTOMER COMPLAINT:

TROUBLESHOOT BRAKE PEDAL

CAUSE OF FAILURE:

LINKAGES FROZEN UP. CAM ON STEERING ARM WORN

RESULTANT DAMAGE:

PEDALS NOT RELEASING WHEN PRESSED

REPAIR PROCESS COMMENTS:

DROVE MACHINE AROUND LOT AND TESTED OPERATION.
FOUND PEDALS TO BE STICKING AND NOT RELEASING.
RIGHT SIDE BRAKE WAS LITTLE OUT OF ADJUSTMENT.
BROUGHT MACHINE INTO SHOP. REMOVED FLOOR PANS TO
ACCESS LINKAGES. LUBRICATED LINKAGES AND LEVERS.
ADJUSTED RIGHT SIDE BRAKE TO MATCH OTHER SIDE.
TESTED OPERATION AND HOLDING TEST ON BRAKES. NO
FURTHER PROBLEMS AT THIS TIME. INSPECTED THE
TILLER LINKAGE FOR THE BLADE CONTROL. ALL THE
BEARINGS AND ROD EYE ENDS NEED REPLACED. LINKAGE
IS LOOSE AND SLOPPY. NO ACTION TAKEN AT THIS



Service Invoice

Invoice:

WO100123532

Ref Doc:

RI11121

P.O. Number:

Invoice Amount:

\$1001.38

Invoice Date:

02/12/16

Sold To: 2104030

BRASS EAGLE INC

DADEG.						
PARTS: OUANTITY	PART NO	DESCRIPTION	STK/NON-STK		UNIT PRICE	EXTENSION
	J-8266	CHAIN LUB.	S		10.54	10.54
11		TOTAL F	PARTS	SEG.	02	10.54
		RT SHOP	LABOR			480.25
		TOTAL I	ABOR	SEG.	02	480.25
		SEGMEN	T 02 TOTAL			490.79
			ES/ENV CHG CY SALES TAX			19.42 T 16.71 T

LIMITED WARRANTY

Ohio CAT warrants all service performed by its service personnel and all New Caterpillar parts provided in connection with such service to be free of workmanship defects for a period of six (6) months or one thousand five hundred (1,500) hours of operation, whichever comes first.

Ohio CAT will repair or replace, at its option, any damaged part involved in the warranty repair.

Unless otherwise agreed by Ohio CAT, such parts and installation labor will be provided without charge to the OWNER/OPERATOR at Ohio CAT's facility or at such other service establishment previously authorized by Ohio CAT at the option of Ohio CAT.

Such repair service is to be provided during provider's regular business hours. OWNER/OPERATOR shall be responsible for all transportation cost associated with transporting the equipment to the site where such repairs are to be performed.

THIS WARRANTY IS NOT APPLICABLE TO FAILURES OR DEFECT RESULTING FROM:

(a) The use of attachments not sold or approved by Ohio CAT; or

(b) Installation of components or other repair work not performed by Ohio CAT which, in the judgment of Ohio CAT, is deemed improper; or

(c) Poor maintenance or abusive operation; or

(d) An application that exceeds the specified limits in the manufacturer specification.

All repairs made by Ohio CAT pursuant to this warranty shall not extend the stated warranty period and the owner/operator shall be responsible for giving prompt written notice of warrantable failure and promptly making the machine available for repair.

In the event of breach of the above warranty, it is expressly understood that the owner/operator's sole remedy shall be the repair or replacement of any damaged part as specifically provided in this warranty, provided, however, that should the parts prove so damaged as to preclude the remedying of warranted workmanship defects by repair or replacement the owner/operator's sole and exclusive remedy shall then be refund of the purchase price of the parts and labor previously furnished or provided by Ohio CAT.

CONDITIONS AND LIMITATIONS:

With the above warranties and limitations understood, Ohio CAT shall in no event be liable for any other losses, damages, costs or expenses claimed by the owner/operator, including but not limited to loss from failure of the equipment to operate for any period of time or business interruption, and all other direct, indirect, special, incidental, punitive or consequential damages, including but not limited to lost revenues, lost profits and indirect income loss, regardless of whether such claim is brought under breach of contract, breach of warranty, tort, strict liability, negligence or other theory of law or equity.

INDEMNIFICATION:

In the event that any services performed under this Work Order Invoice are performed at OWNER/OPERATOR'S facility or worksite, OWNER/OPERATOR shall indemnify, defend and hold harmless Ohio CAT from any damages to property or personal injury suffered by Ohio CAT and/or its personnel occurring while on the site of OWNER/OPERATOR'S facility or worksite (except to the extent caused by the negligent or willful actions of Ohio CAT or its personnel), and Ohio CAT shall indemnify, defend and hold harmless OWNER/OPERATOR for damages to property and personal injury caused by the negligent or willful actions of Ohio CAT or its personnel.

THE WARRANTY SET FORTH ABOVE IS GIVEN IN LIEU OF ALL OTHER WARRANTIES EXPRESS OR IMPLIED AND ALL OTHER WARRANTS ARE HEREBY DISCLAIMED, INCLUDING WITHOUT LIMITATION LIMITING THE IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR ANY PARTICULAR PURPOSE.



Service Invoice

Invoice:

WO100123532

Ref Doc:

RI11121

P.O. Number:

Invoice Amount:

\$1001.38

Invoice Date:

02/12/16

Sold To: 2104030

որդկամակիլինենիցըիկնիիկինոլիինորի

BRASS EAGLE INC 3248 RAINBOW TER

ERLANGER, KY 41018-2229

*

Customer #: 2104030

Remit Payment To:

Ohio CAT Box 774439

4439 Solutions Center Chicago, IL 60677-4004

For Questions, Please Contact:

Melanie Roth 440-838-7444 mroth@ohiocat.com

Ma	ke: CAT Model	D5C III XL	SN: 08Z S	800433		SMU/OD: 4119	9.0
		INVOIC	E SUMMAR	Y:			
SEG	DESCRIPTION	PARTS	LABOR	MISC	F/R ALL	ADJUSTMENT	TOTAL
01	TROUBLESHOOT CHARGING SYSTEM	248.46	226.00				474.46
)2	TROUBLESHOOT BRAKE PEDAL	10.54	480.25				490.79
	SUPPLIES/ENV CHG			19.42			19.42
	SUBTOTAL	259.00	706.25	19.42			984.67
	KENTUCKY SALES TAX			16.71			16.71
	TOTAL	259.00	706.25	36.13			1001.38

PAY THIS AMOUNT

\$1001.38



INVOICE

Shipped To:

PAYMENT TERMS: Net 30 Days from invoice date. A monthly finance charge of 1.5% will be added to all past due amounts. Title to goods remains with seller until full payment is received. Returned parts must be accompanied by invoice or packing list and are subject to a restocking fee. Parts designated with an asterisk (*) are not returnable.





POWER SYSTEMS DIVISION MAIN OFFICE/CLEVELAND 800-637-5000 COMPLETE HYDRAULIC

800-637-5000 CANTON
COMPLETE HYDRAULIC 800-837-6207
SERVICE/BOLIVAR CINCINNATI
800-837-6299 888-332-4658

CADIZ CLEVELAND 800-837-6204 800-837-6200 CANTON COLUMBUS 800-837-6207 888-441-4658 CINCINNATI DAYTON

888-330-4658

LUCASVILLE 888-336-4658 N. KENTUCKY 888-446-4658 PAINESVILLE

888-901-6620

TOLEDO 888-339-4658 YOUNGSTOWN 800-837-6203 ZANESVILLE

800-837-6205

SOLD TO:

000763 000-000-00000-0006-006

BRASS EAGLE INC 7601 US HIGHWAY 42 FLORENCE, KY 41042-5530 SHIP TO:

INVOICE

INVOICE NU	MBER	INVOICE DATE	CUSTOME	R NO.	CUSTOM	ER PURCHASE ORDER NUMBER	STORE	PSO/WC	NO.	PAGE	
WO10010	1334	11-15-04	21040	030		ART	10	RI005	70	1	
MAKE		MODEL	SER	AL NUM	BER	EQUIPMENT NUMBER	METER	READING	DOC. D	ATE	
AA	D50	C III XL	8Z	8ZS00433		8ZS00433 M12882		211	13.0	11-08	-04
QUANTITY		ITEM	*NR		DESCRIPTION		UNIT PR	ICE	EXTENSION		

REPAIR TRANSMISSION

REPAIR POSS TRANS LEAK

WHAT WAS THE COMPLAINT?
TRANSMISSION LEAKING
HOW WAS IT REPAIRED?

THE TECHNICIAN FOUND THAT THE YOKE SHAFT O'RING WAS DAMAGED, WHICH CAUSED A LOSS OF TRANSMISSION HE DROPPED THE BELLY PAN, FINDING THAT THE YOKE SHAFT SEAL IN THE REAR OF THE TRANSMISSION WAS LEAKING. HE REMOVED THE SHEET METAL AND THEN STEAM CLEANED THE MACHINE. THIS WAS DONE HE PULLED IT INTO THE SHOP AND BLOCKED IT UP. THE TRANSMISSION OIL WAS DRAINED AND THE U-JOINTS AND SHAFT WERE REMOVED. THE BEARING CAGE PLATE THAT HOLDS THE LIP SEAL WAS ALSO REMOVED. THE PARTS WERE CLEANED AND A NEW SEAL AND O'RING WAS INSTALLED ONTO THE BEARING CAGE AND A NEW O'RING WAS ALSO INSTALLED ONTO THE YOKE SHAFT. THE U-JOINTS WERE REINSTALLED INTO THE MACHINE AND THEN TIGHTENED. THERE WAS MUD IN THE BELLY PAN, SO THE TECHNICIAN THE FLOOR SHEET METAL WAS CLEANED IT OUT. REINSTALLED AND THE TRANSMISSION WAS FILLED WITH THE MACHINE WAS RAN TO CHECK FOR LEAKS 30W OIL. AND NONE WERE FOUND. THE BELLY PAN WAS REINSTALLED, AND THEN THE MACHINE WAS LUBED AND

* - NOT RETURNABLE

PAYMENT TERMS: Net 30 Days from invoice date. A monthly Finance Charge of 2% (24%APR) will be added on all past due amounts. Title to goods remains with seller until full payment is received. Returned parts must be accompanied by invoice or Packing list and are subject to a restocking fee. Parts designed with an asterick (*) are not returnable.

OHIO2054REMIT

PLEASE REMIT TO:

Ohio CAT BOX 931029 CLEVELAND, OH 44193

PAY THIS:	CONT'D
AMOUNT	CONTR
CREDIT	J. St. 1980 S. S. Sansalisher, M. S.
AMOUNT	





POWER SYSTEMS DIVISION MAIN OFFICE/CLEVELAND 800-637-5000

COMPLETE HYDRAULIC SERVICE/BOLIVAR 800-837-6299 888-332-4658

CADIZ 800-837-6204 CANTON 800-837-6207 CINCINNATI

CLEVELAND 800-837-6200 COLUMBUS 888-441-4658 DAYTON 888-330-4658

888-336-4658 888-446-4658 PAINESVILLE 888-901-6620

LUCASVILLE

888-339-4658 N. KENTUCKY YOUNGSTOWN 800-837-6203 ZANESVILLE 800-837-6205

TOLEDO

SOLD TO:

000-000-00000-00006-006

BRASS EAGLE INC 7601 US HIGHWAY 42 FLORENCE, KY 41042-5530 SHIP TO:

INVOICE

INVOICE NUM	ABER	INVOICE DATE	E CUSTOMER NO.	CUSTOMER	PURCHASE ORD	ER NUMBER	STORE	PSO/W	O NO.	PAG
WO100101	334	11-15-04	2104030		ART		10	R100	570	2
MAKE	MAKE MODEL SERIAL NUMBER		EQUIPMENT	NUMBER	METER	R READING DOC.		ATE		
AA	D50	C III XL	8ZS0043	33	M128	882	211	3.0	11-08	-04
QUANTITY		ITEM	*NR	DESC	RIPTION		UNIT PR	CE	EXTENSION	ě
ALL FLU	IDS C	HECKED.	THE PRE-AIR	CLEANER	R WAS					
CLEANED	OUT	AND COOL	ANT WAS TOPP	ED OFF.	IT WAS					
REMOVED	FROM	THE BLO	CKS AND CHEC	KED OVER	ONE					
LAST TI	ME.	THE MACH	INE CHECKED	OUT AS I	T SHOULD.					
1 5F	-3144	1	SEAL		S		3.47		3.47	
1 7F	-8268	3	SEAL O	R	S		2.44		2.44	
1 8C	-5168	3	SEAL-I	IP TYP	S		12.05	5	12.05	
			TOT	AL PARTS	3	SEG. 01			17.96	*
			RT	SHOP LAE	BOR				738.00	
			TOT	AL LABOR	R	SEG. 01			738.00	*
			SE	GMENT 01	L TOTAL				755.96	т

STEAM CLEAN MACHINE

STEAMCLEAN MACHINE BEFORE COMING INTO THE SHOP PER CAT CONTAMINATION CONTROL PROCEDURES

MACHINE WAS STEAM CLEANED - BELLY PAN WAS DROPPED AND CLEANED AS WELL.

RT SHOP LABOR

90.00

TOTAL LABOR

SEG. 02

90.00 *

* - NOT RETURNABLE

PAYMENT TERMS: Net 30 Days from invoice date. A monthly Finance Charge of 2% (24%APR) will be added on all past due amounts. Title to goods remains with seller until full payment is received. Returned parts must be accompanied by invoice or Packing list and are subject to a restocking fee. Parts designed with an asterick (*) are not returnable.

PLEASE REMIT TO:

Ohio CAT BOX 931029 CLEVELAND, OH 44193

PAY THIS:	CONT'D
AMOUNT	
CREDIT	
AMOUNT	



COLUMBUS (614) 878-2287 1-888-441-4658 CINCINNATI (513) 771-0515 1-888-332-4658 TOLEDO (419) 874-7975 1-888-339-4658

LUCASVILLE (740) 259-2350 1-888-336-4658 DAYTON (937) 335-7660 1-888-330-4658 RICHWOOD, KY (859) 372-4665 1-888-446-4658

SOLD TO:

000180 000-000-00000-00011-002

BRASS EAGLE INC 7601 US HIGHWAY 42 FLORENCE, KY 41042-5530 SHIP TO:

INVOICE

INVOICE NU	MBER	INVOICE DATE	CUSTOMER N	O. CUSTOM	ER PURCHASE ORDER NUMBER	STORE	PSO/W	O NO.	PAGE
PI060045	880	05-15-03	104030		D5C	06	06C01	8384	1
MAKE		MODEL	SERIAL	NUMBER	EQUIPMENT NUMBER	METER	READING	DOC.	DATE
AA	D5	C III XL	08ZS0	0433				05-1	4-03
QUANTITY		ITEM	*NR	DE	SCRIPTION	UNIT PR	ICE	EXTENSIO	N

PARTS SALES PERSON: R JAY EPPERT

1	51-7951	*FUEL FILTER	S	11.15	11.15
1	1R-0734	*FILTER A	S	6.66	6.66
1	4N-0326	*ELEMENT	S	29.12	29.12
1	4N-0313	*ELEMENT	S	29.06	29.06

TOTAL PARTS 75.99 T

KENTUCKY STATE TAX

4.56 T

* - NOT RETURNABLE

PAYMENT TERMS: Net 30 Days from invoice date.

A monthly Finance Carge of 2% (24%APR) will be added on all past due amounts. Title to goods remains with seller until full payment is received. Returned parts must be accompanied by invoice or Packing list and are subject to 10% restocking charge. Parts designed with an asterick (*) are not returnable.

OHIO2054REMIT

PLEASE REMIT TO: Ohio CAT DEPT. NUMBER 495 COLUMBUS, OH 43265 (614) 878-2287

PAY THIS:	80.55
AMOUNT	00.00
CREDIT	
AMOUNT	





HOLT COMPANIES

(614) 878-2287 1-888-441-HOLT (513) 771-0515 1-888-332-HOLT 10LEDO (419) 874-7975 1-888-339-HOLT

LUCASVILLE (740) 259-2350 1-888-336-HOLT DAYTON (937) 335-7660 1-888-330-HOLT

104030

SOLD TO

SHIP TO

BRASS EAGLE, INC 7601 HWY 42 FLORENCE , KY

41042

SERVICE INVOICE A ROY SEEDITH SHY OF SA GELMIN SO SEEDING ROW STARSSANDER SO

40.00

INVOICE NU	MBER	INVOICE DATE	CUSTOMER NO	CUSTOMER PU	RCHASE ORDER NUMBER	STORE	PSO/WO N	NO.	PAGE
W006002	1692	05-31-01	104030	A	RT REED	06	ZW002	85	1
MAKE	r.	NODEL	SERIAL N	UMBER	EQUIPMENT NUMBER		METER READING	DOC.	DATE
AA	D5C	III XL	8ZS00)433			686.0	M12882	1-01
QUANTITY		ITEM	*N/R	DESCRI	PTION	UNI	T PRICE	EXTENSIO	N

SERVICE CALL-MACH. WON'T SHUT DOWN

TROUBLESHOOT ELECTRIC SYSTEM

ENG. WON'T SHUT DOWN-SERVICE CALL-REMOVED LEFT SIDE COVER, FOUND WIRE OFF GOING TO SHUT DOWN SOLINIOD, REPAIRED CONNECTOR, REINSTALLED CHECKS OK AT THIS TIME

TOTAL LABOR SEG. 01 237.00 *

SERV TRK MILEAGE 76.00

TOTAL MISC CHGS SEG. 01 76.00 *

SEGMENT 01 TOTAL 313.00 T

SPLY/ENV KTYMACH add to south the second of the second of

INTOCK! STATE TAX

use of municipal page for finish my of

PAYMENT TERMS: Net 30 Days from invoice date.

A monthly Finance Charge of 2% (24% APR) will be added on all past due amounts. Title to goods remains with seller until full payment is received. Returned parts must be accompanied by invoice or Packing list and are subject to 10% restocking charge. Parts designed with an asterisk (*) are not returnable.

* - NOT RETURNABLE

PLEASE REMIT TO:

HOLT COMPANIES DEPT. NUMBER 495 COLUMBUS, OH 43265 (614) 878-2287

PAY THIS AMOUNT	335.10
CREDIT AMOUNT	